

Monthly SSO Report March 2015

Permit Number	Manhole Number	Location	Receiving Water	Duration Min.	Cause	Volume (gal)	Component	Date	Started	Stopped	Steps taken
AR0033278	FL02-0670	3830 Crystal Lane	ditch	195	Grease	975	Manhole	3/2/2015	10:00 AM	1:15 PM	Jet -Vac, Disinfected and Deodorized
AR0033278	P009-2270	3400 Gary Street	Storm drain	120	Roots	240	Manhole	3/2/2015	1:00 PM	3:00 PM	Jet -Vac
AR0021750	S007-0590	2001 Churchhill Road	yard	150	Grease	1350	Manhole	3/4/2015	7:15 PM	9:45 PM	Jet -Vac, Disinfected and Deodorized
AR0021750	M002-0070	9422 Rogers Avenue	creek	1318	I & I - Rainfall	197,700	Manhole	3/4/2015	12:30 PM	10:28 AM	
AR0021750	M002-1400	3200 Vicksburg	storm drain	1180	I & I - Rainfall	41300	Manhole	3/4/2015	3:00 PM	10:40 AM	
AR0033278	MC05-1315 to 2310	2414 Independence Street	yard	75	Grease	375	Servic Line Overflow	3/4/2015	11:00 AM	12:15 PM	Jet -Vac, Disinfected and Deodorized
AR0033278	Z006-0930	100 Georgetown Lane	yard	70	Grease	350	Manhole	3/4/2015	7:20 AM	8:30 AM	Jet -Vac, Disinfected and Deodorized
AR0033278	P006-0390 to 0380	1417 South 17th Street	Building	30	Grease	300	Servic Line Overflow	3/4/2015	6:30 AM	7:00 AM	Jet -Vac, Disinfected and Deodorized
AR0033278	MC06-0305	1412 Pheonix Avenue	storm drain	1315	I & I - Rainfall	361,625	Manhole	3/4/2015	1:00 PM	10:45 AM	
AR0033278	P007-1990	4131 Stanard Street	paved area	1049	I & I - Rainfall	10490	Manhole	3/4/2015	5:45 PM	1:14 AM	
AR0033278	P009-2390 to 2330	3811 Dallas Street	yard	75	Grease	550	Servic Line Overflow	3/4/2015	3:30 PM	4:45 PM	Jet -Vac, Disinfected and Deodorized
AR0033278	P005-0230 to 0220	1438 Belle Avenue	yard	237	Line Failure/Break	1265	Servic Line Overflow	3/5/2015	1:18 PM	5:15 PM	Jet-Vac
AR0021750	S001-0760 to 0750	3602 Morris Drive	Service line clean out overflow	345	Roots/Grease	50	Servic Line Overflow	3/6/2015	5:12 PM	6:02 PM	Jet -Vac
AR0033278	P006-0380 to 0345	1319 South 17th Street	yard	91	Roots	1065	Servic Line Overflow	3/6/2015	10:19 AM	11:50 AM	Machine Rodded
AR0021750	S003-3670 to 3660	5424 Park Avenue	building	213	Roots	213	Servic Line Overflow	3/8/2015	4:16 PM	7:49 PM	Jet-Vac
AR0021750	RL01-0850 to 0843	7107 South R Street	building	0	Unknown	unknown	Servic Line Overflow	3/8/2015	5:40 PM	5:40 PM	none
AR0033278	Z005-0340	2701 Glen Flora Way	yard	184	Roots	184	Manhole	3/8/2015	3:04 PM	6:08 PM	Jet-Vac
AR0021750	S007-0590	2001 Chruchill Road	yard	100	Grease	900	Manhole	3/9/2015	2:50 PM	4:30 PM	Jet-Vac
AR0021750	MC05-0640 to 0630	4209 Jennylind Road	ditch	60	Grease	60	Main Line	3/10/2015	8:40 AM	9:40 AM	Jet-Vac
AR0021750	S007-0500 to 0490	4109 Morris	Strom Drain	70	Grease	1100	Main Line	3/10/2015	6:50 PM	8:00 PM	Jet-Vac
AR0021750	S003-1665 to 1650	4619 South Q Street	yard	170	Roots	1700	Main Line	3/10/2015	8:00 AM	10:50 AM	Jet-Vac
AR0033278	P009-2270 to 2250	3409 Gary Street	yard	88	I & I - Rainfall	88	Main Line	3/10/2015	8:00 AM	9:28 AM	
AR0021750	S008-2240 to 2140	3428 Armour Avenue	yard	107	Grease	107	Main Line	3/10/2015	11:23 AM	1:10 PM	Jet-Vac
AR0033278	MC05-2500	2700 Houston Street	stromdrain	110	Roots	1100	Manhole	3/10/2015	5:10 PM	7:00 PM	Jet-Vac
AR0033278	P006-0380 to 0340	1319 South 17th Street	yard	20	Grease	500	Main Line	3/10/2015	8:30 AM	8:50 AM	Jet-Vac
AR0033278	Z003-0800 to 0790	3226 iola Street	yard	30	Grease	375	Servic Line Overflow	3/10/2015	9:00 AM	9:30 AM	Jet-Vac
AR0033278	MC07-1420	3611 Cliff Drive	ditch	50	Roots	50	Main Line	3/11/2015	11:30 AM	12:20 PM	Jet-Vac
AR0033278	P003-0260	1322 N 8th StreetP003-0260	yard and strom drain	60	Grease	300	Manhole	3/11/2015	4:50 PM	5:50 PM	Jet-Vac
AR0021750	Z001-0754	5801 Boys Club Ln.	creek	1329	I & I - Rainfall	33,225	Manhole	3/13/2015	12:51 PM	11:00 AM	
AR0021750	RL01-0670	1601 South 74th St.	yard	1065	I & I - Rainfall	106,500	Manhole	3/13/2015	5:00 PM	11:45 AM	
AR0021750	RL01-0690	1801 South 74th St.	yard	1065	I & I - Rainfall	106,500	Manhole	3/13/2015	5:00 PM	11:45 AM	
AR0021750	Z001-0756/0754	5800 Boys Club Ln.	creek	1329	I & I - Rainfall	33,225	Manhole	3/13/2015	12:51 PM	11:00 AM	
AR0021750	M002-1400	3200 Vicksburg St.	paved area	1632	I & I - Rainfall	16,320	Manhole	3/13/2015	12:38 PM	3:50 PM	
AR0021750	RL01-0680	1601 South 74th St.	yard	2240	I & I - Rainfall	106,500	Manhole	3/13/2015	5:00 PM	11:40 AM	
AR0021750	FC02-0866	12920 Brittany Drive	creek	2030	I & I - Rainfall	507,500	Manhole	3/13/2015	1:50 PM	11:40 AM	

AR0033278	MC06-0305	1412 Phoenix Ave	creek	1385	I & I - Rainfall	138,500	Manhole	3/13/2015	11:39 AM	11:35 AM	
AR0033278	MC06-1970	5601 Jenny Lind Rd.	creek	1319	I & I - Rainfall	362,725	Manhole	3/13/2015	12:51 PM	10:50 AM	
AR0033278	S007-1380 to 1370	1313 North 50th Street	yard	9	I & I - Rainfall	10	Servic Line Overflow	3/13/2015	2:34 PM	2:43 PM	Machine rodded
AR0033278	P009-1990	4231 Standard St.	paved area	1390	I & I - Rainfall	69,500	Manhole	3/13/2015	4:28 PM	3:38 PM	
AR0033278	P009-0200	1823 South 31 St.	yard	1065	I & I - Rainfall	26,625	Manhole	3/13/2015	11:55 AM	5:40 PM	
AR0033278	P009-2255	3403 Gary Street	yard	870	I & I - Rainfall	21,750	Servic Line Overflow	3/13/2015	9:30 PM	12:00 PM	
AR0033278	P009-2250 to 2210	3409 Gary Street	yard	1136	I & I - Rainfall	28,400	Servic Line Overflow	3/13/2015	5:04 PM	12:00 PM	
AR0033278	S008-1260	2143 Churchill Rd.	Storm drain	60	Roots/Grease	6000	Manhole	3/13/2015	2:30 PM	3:30 PM	
AR0033278	MC06-1120	1413 Phoenix Ave	creek	997	I & I - Rainfall	99,700	Manhole	3/13/2015	5:58 PM	10:38 AM	
AR0021750	S007-1290 to 1280	1401 North 50th St.	yard	52	Grease	1300	Servic Line Overflow	3/14/2015	2:08 PM	3:00 PM	Machine Rodded, Disinfected and Deodorized
AR0033278	Z001-1860 to 1870	2903 Quincy Street	yard	56	Grease	560	Servic Line Overflow	3/14/2015	8:16 PM	9:20 PM	Jet-Vac
AR0033278	P009-2255 to 2250	3409 Gary Street	yard	60	Line Failure/Break	60	Servic Line Overflow	3/15/2015	9:40 AM	10:40 AM	
AR0021750	S006-2000	1447 North 52nd	Ditch	60	Grease	600	Manhole	3/17/2015	1:17 PM	2:17 PM	Jet-Vac
AR0033278	MC06-0400 to 0390	1803 Phoenix Avenue	yard	90	Roots	300	Main Line	3/17/2015	5:45 PM	7:15 PM	
AR0033278	FL02-0670	3830 Crystal Lane	ditch	20	Unknown	100	Manhole	3/23/2015	2:10 PM	2:30 PM	
AR0033278	MC03-0445 to 0440	2822 South 14th Street	yard	135	Roots	135	Main Line	3/25/2015	6:00 PM	8:15 PM	Jet-Vac, Machine rodded
AR0021750	S007-1430 to 1410	1305 North 49th Street	ditch	47	Roots	47	Main Line	3/27/2015	3:55 PM	4:45 PM	Disinfected and Deodorized
AR0021750	S001-0760 to 0750	2020 South 66th Street	ditch	90	Roots	90	Main Line	3/27/2015	4:19 PM	5:49 PM	Made repair
AR0033278	P007-unkto 0010	3320 North M Street	yard	85	Roots	85	Main Line	3/27/2015	3:00 PM	4:25 PM	Jet-Vac

Fort Smith Utilities

March 2015 SSO Monthly Report

CONFIRMATION NUMBER

1C2034EA-FF46-44A8-8692-834AE2A1923B

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

[Close this window](#) [Print this page](#)

24-Hour Sanitary Sewer Overflow Report

SSO ID#: 1C2034EA-FF46-44A8-8692-834AE2A1923B

Date Sent: 3/15/2015

SSO Bypass Upset

Facility Permit Number: **AR0033278**

Date Overflow Began: **3/14/2015**

Date Overflow Ended: **3/14/2015**

Location:

Facility name:

Time:

Time:

P Street WWTP

8:16 pm

9:20 pm

2903 Quincy Street Z001-1860 to1870

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

(Enter overflow type if not listed)

Volume:

560

(Give an estimate in gallons)

Impact of SSO Event:

SSO Affected Private Property (ground)

Cause of Overflow

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause:

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- Machine rodded
- Jet-Vac
- Hand rodded
- Used Generator To Power Pumps/Equipment
- Other: Describe
- Disinfected and Deodorized
- Hydro Cleaned
- Spread Lime on Affected Area
- Public Notification

Environmental Damage

- OEHC - Observed or Evidence of Human Contact
- NEAH - No Evidence of Adverse Health/Environmental Impact
- OEEI - Observed or Evidence of Environmental Impact
- EFK - Evidence of Fish Kill

Reported By **Steve Floyd** Title **Supt.** Telephone Number **(479) 784-2331**

Additional Comments if Needed:

Cleanup scheduled

Email a Copy of This Report to the Email Address:

sfloyd@fortsmithar.gov

CONFIRMATION NUMBER

2535DF67-D6F7-47C5-ABCD-B1CDED8FAA1B

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

[Close this window](#) [Print this page](#)

24-Hour Sanitary Sewer Overflow Report

SSO ID#: 2535DF67-D6F7-47C5-ABCD-B1CDED8FAA1B

Date Sent: 3/26/2015

SSO Bypass Upset

Facility Permit Number: **AR0033278**

Facility name:

P Street

Date Overflow Began: **3/25/2015**

Time:

6:00 pm

Date Overflow Ended: **3/25/2015**

Time:

8:15 pm

Location: **2822 South 14th Street, Between Manholes MC03-0445 and MC030440, yard**

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

(Enter overflow type if not listed)

Volume:

135

(Give an estimate in gallons)

Impact of SSO Event:

SSO Affected Private Property (ground)

Cause of Overflow

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause:

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- Machine rodded
- Disinfected and Deodorized
- Jet-Vac
- Hydro Cleaned
- Hand rodded
- Spread Lime on Affected Area
- Used Generator To Power Pumps/Equipment
- Public Notification
- Other: Describe

Environmental Damage

- OEHC - Observed or Evidence of Human Contact
- NEAH - No Evidence of Adverse Health/Environmental Impact
- OEEI - Observed or Evidence of Environmental Impact
- EFK - Evidence of Fish Kill

Reported By **Jimmie B. Johnson**

Title **Superintendent**

Telephone Number **(479) 784-2231**

Additional Comments if Needed:

Email a Copy of This Report to the Email Address:

jjohnson@fsark.com

CONFIRMATION NUMBER.

30CDD84F-0ADD-4E36-94A9-846BBA34A2AF

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

[Close this window](#) [Print this page](#)

24-Hour Sanitary Sewer Overflow Report

SSO ID#: 30CDD84F-0ADD-4E36-94A9-846BBA34A2AF
Date Sent: 3/27/2015

SSO Bypass Upset

Facility Permit Number: AR0033278
Date Overflow Began: 3/27/2015
Date Overflow Ended: 3/27/2015
Location:

Facility name:
Time:
Time:

P Street
3:00 pm
4:25 pm

3320 North M Street, between manholes P007-unk and P007-0010, Yard

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

(Enter overflow type if not listed)

Volume: 85

(Give an estimate in gallons)

Impact of SSO Event: SSO Affected Private Property (ground)

Cause of Overflow

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause:

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- Machine rodded Disinfected and Deodorized
- Jet-Vac Hydro Cleaned
- Hand rodded Spread Lime on Affected Area
- Used Generator To Power Pumps/Equipment Public Notification
- Other: Describe

Environmental Damage

- OEHC - Observed or Evidence of Human Contact NEAH - No Evidence of Adverse Health/Environmental Impact
- OEEI - Observed or Evidence of Environmental Impact EFK - Evidence of Fish Kill

Reported By **Jimmie B. Johnson**

Title **Superintendent**

Telephone Number **(479) 784-2231**

Additional Comments if Needed:

Email a Copy of This Report to the Email Address:
jjohnson@fsark.com

24-Hour Sanitary Sewer Overflow Report

SSO ID#: 7EB89FFA-5B47-44D1-A096-A6D326C852D0

Date Sent: 3/28/2015

SSO Bypass Upset

Facility Permit Number: **AR0021750**

Facility name:

Massard

Date Overflow Began: **3/27/2015**

Time:

4:19 pm

Date Overflow Ended: **3/27/2015**

Time:

5:49 pm

Location:

2020 South 66th Street, between Manholes S001-1190 and S001-1185, ditch

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

(Enter overflow type if not listed)

Volume: 90

(Give an estimate in gallons)

Impact of SSO Event: SSO Reached Receiving Water (river, stream)

Cause of Overflow

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause:

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- Machine rodded
- Jet-Vac
- Hand rodded
- Used Generator To Power Pumps/Equipment
- Other: Describe
- Disinfected and Deodorized
- Hydro Cleaned
- Spread Lime on Affected Area
- Public Notification

made repair

Environmental Damage

- OEHC - Observed or Evidence of Human Contact
- OEEI - Observed or Evidence of Environmental Impact
- NEAH - No Evidence of Adverse Health/Environmental Impact
- EFK - Evidence of Fish Kill

Reported By **Jimmie B. Johnson**

Title **Superintendent**

Telephone Number **(479) 784-2231**

Additional Comments if Needed:

Email a Copy of This Report to the Email Address:

jjohnson@fortsmithar.gov

CONFIRMATION NUMBER

84FFE415-6308-43E4-91B3-A219A450BB57

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

Close this window Print this page

24-Hour Sanitary Sewer Overflow Report

SSO ID#: 84FFE415-6308-43E4-91B3-A219A450BB57
Date Sent: 3/27/2015

[x] SSO [] Bypass [] Upset

Facility Permit Number: AR0021750
Date Overflow Began: 3/27/2015
Date Overflow Ended: 3/27/2015
Location: 1305 North 49th Street, between Manhole S007-1430 and S007-1410, Ditch

Facility name:
Time:
Time:

Massard
3:55 pm
4:45 pm

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- [] Manhole Overflow
[] Lift Station Overflow
[x] Main Line Overflow
[] Service Line Overflow
[] Other Overflow Type:

(Enter overflow type if not listed)

Volume: 47

(Give an estimate in gallons)

Impact of SSO Event: SSO Reached Receiving Water (river,stream)

Cause of Overflow

- [] I & I - Rainfall
[x] Roots
[] Grease
[] Debris
[] Equipment Failure
[] Construction
[] Vandalism
[] Power Failure
[] Line Failure/Break
[] Other Cause:

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- [] Machine rodded [x] Disinfected and Deodorized
[] Jet-Vac [] Hydro Cleaned
[] Hand rodded [] Spread Lime on Affected Area
[] Used Generator To Power Pumps/Equipment [] Public Notification
[] Other: Describe

Environmental Damage

- [] OEHC - Observed or Evidence of Human Contact [x] NEAH - No Evidence of Adverse Health/Environmental Impact
[] OEEI - Observed or Evidence of Environmental Impact [] EFK - Evidence of Fish Kill

Reported By Jimmie B. Johnson

Title Superintendent

Telephone Number (479) 784-2231

Additional Comments if Needed:

Email a Copy of This Report to the Email Address:
jjohnson@fsark.com

CONFIRMATION NUMBER

233D087C-0BD9-40BC-A032-DBC2FE2E260C

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

[Close this window](#) [Print this page](#)

24-Hour Sanitary Sewer Overflow Report

SO ID#: 233D087C-0BD9-40BC-A032-DBC2FE2E260C

Date Sent: 3/16/2015

SSO Bypass Upset

Facility Permit Number: **AR0033278**

Facility name:

P Street WWTP

Date Overflow Began: **3/13/2015**

Time:

2:34 pm

Date Overflow Ended: **3/13/2015**

Time:

2:43 pm

Location: **1313 North 50th Street S007-1380 to 1370**

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

Cause of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause:

(Enter overflow type if not listed)

Volume: **10**

(Give an estimate in gallons)

Impact of SSO Event: **SSO Affected Private Property (ground)**

Action Taken - Check all that apply

Short term and long-term action, including clean-up and any plans to remediate I & I).

- Machine rodded Disinfected and Deodorized
- Jet-Vac Hydro Cleaned
- Hand rodded Spread Lime on Affected Area
- Used Generator To Power Pumps/Equipment Public Notification
- Other: Describe

Environmental Damage

- OEHC - Observed or Evidence of Human Contact NEAH - No Evidence of Adverse Health/Environmental Impact
- OEEI - Observed or Evidence of Environmental Impact EFK - Evidence of Fish Kill

Reported By **Steve Floyd**

Title **Supt.**

Telephone Number **(479) 784-2331**

Additional Comments if Needed:

Report misplaced and not noted until today. Cleanup scheduled.

Email a Copy of This Report to the Email Address:

floyd@fortsmithar.gov

CONFIRMATION NUMBER

BCF3D7D3-36D1-46BC-9AE2-D76814D29B0A

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

Close this window Print this page

24-Hour Sanitary Sewer Overflow Report

SSO ID#: BCF3D7D3-36D1-46BC-9AE2-D76814D29B0A
Date Sent: 3/23/2015

SSO Bypass Upset

Facility Permit Number: AR0033278
Date Overflow Began: 3/23/2015
Date Overflow Ended: 3/23/2015
Location: 3830 Crystal Lane, Manhole FL02-0670,ditch

Facility name:
Time:
Time:

P Street
2:10 pm
2:30 pm

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
Lift Station Overflow
Main Line Overflow
Service Line Overflow
Other Overflow Type:

(Enter overflow type if not listed)

Volume: 100

(Give an estimate in gallons)

Impact of SSO Event: SSO Reached Receiving Water (river,stream)

Cause of Overflow

- I & I - Rainfall
Roots
Grease
Debris
Equipment Failure
Construction
Vandalism
Power Failure
Line Failure/Break
Other Cause: unknown

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- Machine rodded
Jet-Vac
Hand rodded
Used Generator To Power Pumps/Equipment
Other: Describe none
Disinfected and Deodorized
Hydro Cleaned
Spread Lime on Affected Area
Public Notification

Environmental Damage

- OEHC - Observed or Evidence of Human Contact
NEAH - No Evidence of Adverse Health/Environmental Impact
OEEI - Observed or Evidence of Environmental Impact
EFK - Evidence of Fish Kill

Reported By Jimmie B. Johnson

Title Superintendent

Telephone Number (479) 784-2231

Additional Comments if Needed:

Manhole was found with evidence of an overflow, but no active overflow.

Email a Copy of This Report to the Email Address:

jjohnson@fsark.com

CONFIRMATION NUMBER

452DD75E-C17B-4321-A297-32FC061EE421

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

[Close this window](#) [Print this page](#)

24-Hour Sanitary Sewer Overflow Report

SSO ID#: 452DD75E-C17B-4321-A297-32FC061EE421

Date Sent: 3/13/2015

SSO Bypass Upset

Facility Permit Number: **AR0033278**

Facility name:

P Street WWTP

Date Overflow Began: **3/13/2015**

Time:

2:30 pm

Date Overflow Ended: **3/13/2015**

Time:

3:30 pm

Location:

2143 Churchill Rd. S008-1260

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

(Enter overflow type if not listed)

Volume: 6000

(Give an estimate in gallons)

Impact of SSO Event: SSO Reached Receiving Water (river,stream)

Cause of Overflow

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause:

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- Machine rodded
- Disinfected and Deodorized
- Jet-Vac
- Hydro Cleaned
- Hand rodded
- Spread Lime on Affected Area
- Used Generator To Power Pumps/Equipment
- Public Notification

Other: Describe

Environmental Damage

- OEHC - Observed or Evidence of Human Contact
- NEAH - No Evidence of Adverse Health/Environmental Impact
- OEEI - Observed or Evidence of Environmental Impact
- EFK - Evidence of Fish Kill

Reported By **Steve Floyd** Title **Supt.** Telephone Number **(479) 784-2331**

Additional Comments if Needed:

[Empty text box for additional comments]

Email a Copy of This Report to the Email Address:

Sfloyd@fortsmithar.gov

CONFIRMATION NUMBER

6256C22A-B362-4B29-9A1A-9462529C9559

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

[Close this window](#) [Print this page](#)

24-Hour Sanitary Sewer Overflow Report

SSO ID#: 6256C22A-B362-4B29-9A1A-9462529C9559

Date Sent: 3/15/2015

SSO Bypass Upset

Facility Permit Number:	AR0033278	Facility name:	P Street WWTP
Date Overflow Began:	3/15/2015	Time:	9:40 am
Date Overflow Ended:	3/15/2015	Time:	10:40 am

Location: 3409 Gary Street P009-2255 to 2250 Line failure, debris removed & flow restored. Repair scheduled.

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

(Enter overflow type if not listed)

Volume: **60**

(Give an estimate in gallons)

Impact of SSO Event: **SSO Affected Private Property (ground)**

Cause of Overflow

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause:

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- Machine rodded Disinfected and Deodorized
- Jet-Vac Hydro Cleaned
- Hand rodded Spread Lime on Affected Area
- Used Generator To Power Pumps/Equipment Public Notification
- Other: Describe

Environmental Damage

- OEHC - Observed or Evidence of Human Contact NEAH - No Evidence of Adverse Health/Environmental Impact
- OEEI - Observed or Evidence of Environmental Impact EFK - Evidence of Fish Kill

Reported By **Steve Floyd** Title **Supt.** Telephone Number **(479) 784-2331**

Additional Comments if Needed:

Email a Copy of This Report to the Email Address:

sfloyd@fortsmithar.gov

CONFIRMATION NUMBER

B7DEAC48-FEE0-444F-8B4E-85B8360467DC

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

[Close this window](#) [Print this page](#)

24-Hour Sanitary Sewer Overflow Report

SSO ID#: B7DEAC48-FEE0-444F-8B4E-85B8360467DC

Date Sent: 3/14/2015

SSO Bypass Upset

Facility Permit Number: AR0021750

Facility name:

Massard WWTP

Date Overflow Began: 3/14/2015

Time:

2:08 pm

Date Overflow Ended: 3/14/2015

Time:

3:00 pm

Location:

1401 North 50th St. S007-1290 to 1280

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

(Enter overflow type if not listed)

Volume: 1300

(Give an estimate in gallons)

Impact of SSO Event: SSO Affected Private Property (ground)

Cause of Overflow

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause:

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- Machine rodded
- Disinfected and Deodorized
- Jet-Vac
- Hydro Cleaned
- Hand rodded
- Spread Lime on Affected Area
- Used Generator To Power Pumps/Equipment
- Public Notification

Other: Describe

Environmental Damage

- OEHC - Observed or Evidence of Human Contact
- NEAH - No Evidence of Adverse Health/Environmental Impact
- OEEI - Observed or Evidence of Environmental Impact
- EFK - Evidence of Fish Kill

Reported By **Steve Floyd** Title **Supt.** Telephone Number **(479) 784-2331**

Additional Comments if Needed:

Email a Copy of This Report to the Email Address:

CONFIRMATION NUMBER

66A76402-C47C-4AC8-B377-7ADA25309838

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

[Close this window](#) [Print this page](#)

24-Hour Sanitary Sewer Overflow Report

SSO ID#: 66A76402-C47C-4AC8-B377-7ADA25309838

Date Sent: 3/15/2015

SSO Bypass Upset

Facility Permit Number: **AR0021750**

Facility name: **Massard WWTP**

Date Overflow Began: **3/13/2015**

Time: **1:50 pm**

Date Overflow Ended: **3/15/2015**

Time: **11:40 am**

Location:

12920 Brittany Drive FC02-0866

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

(Enter overflow type if not listed)

Volume: 507,500

(Give an estimate in gallons)

Impact of SSO Event: SSO Reached Receiving Water (river,stream)

Cause of Overflow

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause:

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- Machine rodded Disinfected and Deodorized
- Jet-Vac Hydro Cleaned
- Hand rodded Spread Lime on Affected Area
- Used Generator To Power Pumps/Equipment Public Notification

Other: Describe

Environmental Damage

- OEHC - Observed or Evidence of Human Contact NEAH - No Evidence of Adverse Health/Environmental Impact
- OEEI - Observed or Evidence of Environmental Impact EFK - Evidence of Fish Kill

Reported By **Steve Floyd** Title **Supt.** Telephone Number **(479) 784-2331**

Additional Comments if Needed:

While the overflow occurred within the City's system, the overflow eventually entered the City of Barling's sewer lagoon system. Cleanup is scheduled.

Email a Copy of This Report to the Email Address:

sfloyd@fortsmithar.gov

CONFIRMATION NUMBER

31B17CDE-928B-4CC6-86C3-40E85D3227AF

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

[Close this window](#) [Print this page](#)

24-Hour Sanitary Sewer Overflow Report

SSO ID#: 31B17CDE-928B-4CC6-86C3-40E85D3227AF

Date Sent: 3/14/2015

SSO Bypass Upset

Facility Permit Number: **AR0033278**

Facility name:

P Street WWTP

Date Overflow Began: **3/13/2015**

Time:

4:28 pm

Date Overflow Ended: **3/14/2015**

Time:

3:38 pm

Location: **4231 Standard St. P009-1990**

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

(Enter overflow type if not listed)

Volume: 69,500

(Give an estimate in gallons)

Impact of SSO Event: SSO Reached Receiving Water (river,stream)

Cause of Overflow

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause:

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- Machine rodded Disinfected and Deodorized
- Jet-Vac Hydro Cleaned
- Hand rodded Spread Lime on Affected Area
- Used Generator To Power Pumps/Equipment Public Notification
- Other: Describe

Environmental Damage

- OEHC - Observed or Evidence of Human Contact NEAH - No Evidence of Adverse Health/Environmental Impact
- OEEI - Observed or Evidence of Environmental Impact EFK - Evidence of Fish Kill

Reported By **Steve Floyd** Title **Supt.** Telephone Number **(479) 784-2331**

Additional Comments if Needed:

Cleanup scheduled

Email a Copy of This Report to the Email Address:

sfloyd@fortsmithar.gov

CONFIRMATION NUMBER

0F8FF4B1-5D0F-466C-BF16-C5A1DA8445F4

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

[Close this window](#) [Print this page](#)

24-Hour Sanitary Sewer Overflow Report

SSO ID#: 0F8FF4B1-5D0F-466C-BF16-C5A1DA8445F4

Date Sent: 3/14/2015

SSO Bypass Upset

Facility Permit Number:

AR0021750

Facility name:

Massard WWTP

Date Overflow Began:

3/13/2015

Time:

12:38 pm

Date Overflow Ended:

3/14/2015

Time:

3:50 pm

Location:

3200 Vicksburg St. M002-1400

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

(Enter overflow type if not listed)

Volume:

16,320

(Give an estimate in gallons)

Impact of SSO Event:

SSO Reached Receiving Water (river,stream)

Cause of Overflow

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause:

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- Machine rodded
- Jet-Vac
- Hand rodded
- Used Generator To Power Pumps/Equipment
- Other: Describe
- Disinfected and Deodorized
- Hydro Cleaned
- Spread Lime on Affected Area
- Public Notification

Environmental Damage

- OEHC - Observed or Evidence of Human Contact
- OE EI - Observed or Evidence of Environmental Impact
- NEAH - No Evidence of Adverse Health/Environmental Impact
- EFK - Evidence of Fish Kill

Reported By **Steve Floyd** Title **Supt.** Telephone Number **(479) 784-2331**

Additional Comments if Needed:

Cleanup scheduled

Email a Copy of This Report to the Email Address:

sfloyd@fortsmithar.gov

CONFIRMATION NUMBER

AE184660-1E08-4CFA-94C7-C63880D63A76

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

[Close this window](#) [Print this page](#)

24-Hour Sanitary Sewer Overflow Report

SSO ID#: AE184660-1E08-4CFA-94C7-C63880D63A76

Date Sent: 3/18/2015

SSO Bypass Upset

Facility Permit Number: AR0021750

Facility name: Massard

Date Overflow Began: 3/17/2015

Time: 1:17 pm

Date Overflow Ended: 3/17/2015

Time: 2:17 pm

Location: 1447 North 52nd, Manhole S006-2000, Ditch

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

Cause of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause:

(Enter overflow type if not listed)

Volume: 600

(Give an estimate in gallons)

Impact of SSO Event: SSO Reached Receiving Water (river,stream)

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- Machine rodded Disinfected and Deodorized
- Jet-Vac Hydro Cleaned
- Hand rodded Spread Lime on Affected Area
- Used Generator To Power Pumps/Equipment Public Notification
- Other: Describe

Environmental Damage

- OEHC - Observed or Evidence of Human Contact NEAH - No Evidence of Adverse Health/Environmental Impact
- OEEI - Observed or Evidence of Environmental Impact EFK - Evidence of Fish Kill

Reported By Jimmie B. Johnson

Title Superintendent

Telephone Number (479) 784-2274

Additional Comments if Needed:

Email a Copy of This Report to the Email Address:

jjohnson@fsark.com

CONFIRMATION NUMBER

FFD56C51-E0ED-433F-AB39-473E14FD79A4

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

[Close this window](#) [Print this page](#)

24-Hour Sanitary Sewer Overflow Report

SSO ID#: FFD56C51-E0ED-433F-AB39-473E14FD79A4

Date Sent: 3/18/2015

SSO Bypass Upset

Facility Permit Number: **AR0033278**

Facility name:

P Street

Date Overflow Began: **3/17/2015**

Time:

5:45 pm

Date Overflow Ended: **3/17/2015**

Time:

7:15 pm

Location:

1803 Phoenix Avenue, between manholes MC06-0400 and MC06-0390, yard

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

(Enter overflow type if not listed)

Cause of Overflow

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause:

Volume:

300

(Give an estimate in gallons)

Impact of SSO Event:

SSO Affected Private Property (ground)

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- Machine rodded
- Jet-Vac
- Hand rodded
- Used Generator To Power Pumps/Equipment
- Other: Describe
- Disinfected and Deodorized
- Hydro Cleaned
- Spread Lime on Affected Area
- Public Notification

Environmental Damage

- OEHC - Observed or Evidence of Human Contact
- OEEI - Observed or Evidence of Environmental Impact
- NEAH - No Evidence of Adverse Health/Environmental Impact
- EFK - Evidence of Fish Kill

Reported By **Jimmie B. Johnson**

Title **Superintendent**

Telephone Number **(479) 784-2231**

Additional Comments if Needed:

Email a Copy of This Report to the Email Address:
jjohnson@fsark.com

CONFIRMATION NUMBER

E4E39473-5560-43E0-BEC0-82EC16CABEEB

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

[Close this window](#) [Print this page](#)

24-Hour Sanitary Sewer Overflow Report

SSO ID#: E4E39473-5560-43E0-BEC0-82EC16CABEEB

Date Sent: 3/14/2015

SSO Bypass Upset

Facility Permit Number: **AR0033278**

Facility name:

P Street WWTP

Date Overflow Began: **3/13/2015**

Time:

11:55 am

Date Overflow Ended: **3/14/2015**

Time:

5:40 pm

Location: **1823 South 31 St. P009-0200**

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

(Enter overflow type if not listed)

Volume: **26,625**

(Give an estimate in gallons)

Impact of SSO Event: **SSO Reached Receiving Water (river,stream)**

Cause of Overflow

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause:

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- Machine rodded Disinfected and Deodorized
- Jet-Vac Hydro Cleaned
- Hand rodded Spread Lime on Affected Area
- Used Generator To Power Pumps/Equipment Public Notification
- Other: Describe

Environmental Damage

- OEHC - Observed or Evidence of Human Contact NEAH - No Evidence of Adverse Health/Environmental Impact
- OEEI - Observed or Evidence of Environmental Impact EFK - Evidence of Fish Kill

Reported By **Steve Floyd** Title **Supt.** Telephone Number **(479) 784-2331**

Additional Comments if Needed:

Cleanup scheduled

Email a Copy of This Report to the Email Address:

Sfloyd@fortsmithar.gov

CONFIRMATION NUMBER

12C4A172-98EF-4682-9E4B-C009C9B3AA9A

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

[Close this window](#) [Print this page](#)

24-Hour Sanitary Sewer Overflow Report

SSO ID#: 12C4A172-98EF-4682-9E4B-C009C9B3AA9A

Date Sent: 3/14/2015

SSO Bypass Upset

Facility Permit Number:

AR0021750

Facility name:

Massard WWTP

Date Overflow Began:

3/13/2015

Time:

5:00 pm

Date Overflow Ended:

3/14/2015

Time:

11:40 am

Location:

1601 South 74th St. RL01-0670

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

(Enter overflow type if not listed)

Volume:

1120

(Give an estimate in gallons)

Impact of SSO Event:

SSO Reached Receiving Water (river,stream)

Cause of Overflow

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause:

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- Machine rodded
- Jet-Vac
- Hand rodded
- Used Generator To Power Pumps/Equipment
- Other: Describe
- Disinfected and Deodorized
- Hydro Cleaned
- Spread Lime on Affected Area
- Public Notification

Environmental Damage

- OEHC - Observed or Evidence of Human Contact
- OEEI - Observed or Evidence of Environmental Impact
- NEAH - No Evidence of Adverse Health/Environmental Impact
- EFK - Evidence of Fish Kill

Reported By **Steve Floyd** Title **Supt.** Telephone Number **(479) 784-2331**

Additional Comments if Needed:

Cleanup scheduled

Email a Copy of This Report to the Email Address:

Sfloyd@fortsmithar.gov

CONFIRMATION NUMBER

E32B380C-5DA3-417C-B2A9-F75D6AE6488C

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

[Close this window](#) [Print this page](#)

24-Hour Sanitary Sewer Overflow Report

SSO ID#: E32B380C-5DA3-417C-B2A9-F75D6AE6488C

Date Sent: 3/14/2015

SSO Bypass Upset

Facility Permit Number: AR0021750

Facility name:

Massard WWTP

Date Overflow Began: 3/13/2015

Time:

5:00 pm

Date Overflow Ended: 3/14/2015

Time:

11:45 am

Location:

1801 South 74th St. RL01-0690

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

(Enter overflow type if not listed)

Cause of Overflow

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause:

Volume: 106,500

(Give an estimate in gallons)

Impact of SSO Event: SSO Reached Receiving Water (river,stream)

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- Machine rodded
- Jet-Vac
- Hand rodded
- Used Generator To Power Pumps/Equipment
- Disinfected and Deodorized
- Hydro Cleaned
- Spread Lime on Affected Area
- Public Notification

Other: Describe

Environmental Damage

- OEHC - Observed or Evidence of Human Contact
- OEEI - Observed or Evidence of Environmental Impact
- NEAH - No Evidence of Adverse Health/Environmental Impact
- EFK - Evidence of Fish Kill

Reported By **Steve Floyd** Title **Supt.** Telephone Number **(479) 784-2331**

Additional Comments if Needed:

Cleanup scheduled

Email a Copy of This Report to the Email Address:

sfloyd@fortsmithar.gov

CONFIRMATION NUMBER

08A0C447-21C5-488F-B788-4CB13E972389

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

[Close this window](#) [Print this page](#)

24-Hour Sanitary Sewer Overflow Report

SSO ID#: 08A0C447-21C5-488F-B788-4CB13E972389

Date Sent: 3/14/2015

SSO Bypass Upset

Facility Permit Number: **AR0021750**

Facility name:

Massard WWTP

Date Overflow Began: **3/13/2015**

Time:

5:00 pm

Date Overflow Ended: **3/14/2015**

Time:

11:45 am

Location:

1601 South 74th St. RL01-0680

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

(Enter overflow type if not listed)

Cause of Overflow

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause:

Volume:

106,500

(Give an estimate in gallons)

Impact of SSO Event:

SSO Reached Receiving Water (river,stream)

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- Machine rodded
- Jet-Vac
- Hand rodded
- Used Generator To Power Pumps/Equipment
- Disinfected and Deodorized
- Hydro Cleaned
- Spread Lime on Affected Area
- Public Notification

Other: Describe

Environmental Damage

- OEHC - Observed or Evidence of Human Contact
- OEEI - Observed or Evidence of Environmental Impact
- NEAH - No Evidence of Adverse Health/Environmental Impact
- EFK - Evidence of Fish Kill

Reported By **Steve Floyd** Title **Supt.** Telephone Number **(479) 784-2331**

Additional Comments if Needed:

Cleanup scheduled

Email a Copy of This Report to the Email Address:

Sfloyd@fortsmithar.gov

CONFIRMATION NUMBER

4A28DFFB-3176-46A6-AD35-54C6D9306C5A

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

[Close this window](#) [Print this page](#)

24-Hour Sanitary Sewer Overflow Report

SSO ID#: 4A28DFFB-3176-46A6-AD35-54C6D9306C5A

Date Sent: 3/14/2015

SSO Bypass Upset

Facility Permit Number:

AR0033278

Facility name:

P Street WWTP

Date Overflow Began:

3/13/2015

Time:

9:30 pm

Date Overflow Ended:

3/14/2015

Time:

12:00 pm

Location:

3403 Gary Street P009-2255

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

(Enter overflow type if not listed)

Volume:

21,750

(Give an estimate in gallons)

Impact of SSO Event:

SSO Affected Private Property (ground)

Cause of Overflow

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause:

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- Machine rodded Disinfected and Deodorized
- Jet-Vac Hydro Cleaned
- Hand rodded Spread Lime on Affected Area
- Used Generator To Power Pumps/Equipment Public Notification
- Other: Describe

Environmental Damage

- OEHC - Observed or Evidence of Human Contact NEAH - No Evidence of Adverse Health/Environmental Impact
- OEEI - Observed or Evidence of Environmental Impact EFK - Evidence of Fish Kill

Reported By **Steve Floyd** Title **Supt.** Telephone Number **(479) 784-2331**

Additional Comments if Needed:

Cleanup scheduled

Email a Copy of This Report to the Email Address:

sfloyd@fortsmithar.gov

CONFIRMATION NUMBER

FD7E678B-9C92-42B1-AFAA-3C25947054EB

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

[Close this window](#) [Print this page](#)

24-Hour Sanitary Sewer Overflow Report

SSO ID#: FD7E678B-9C92-42B1-AFAA-3C25947054EB

Date Sent: 3/14/2015

SSO Bypass Upset

Facility Permit Number: **AR0033278**

Date Overflow Began: **3/13/2015**

Date Overflow Ended: **3/14/2015**

Location:

1413 Phoenix Ave MC06-1120

1413

Facility name:

Time:

Time:

Past reset WWTP

5:58 pm

10:35 am

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

(Enter overflow type if not listed)

Volume: 99,700

(Give an estimate in gallons)

Impact of SSO Event: SSO Reached Receiving Water (river, stream)

Cause of Overflow

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause:

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- Machine rodded
- Jet-Vac
- Hand rodded
- Used Generator To Power Pumps/Equipment
- Other: Describe
- Disinfected and Deodorized
- Hydro Cleaned
- Spread Lime on Affected Area
- Public Notification

Environmental Damage

- OEHC - Observed or Evidence of Human Contact
- OEEI - Observed or Evidence of Environmental Impact
- NEAH - No Evidence of Adverse Health/Environmental Impact
- EFK - Evidence of Fish Kill

Reported By **Steve Floyd** Title **Supt.** Telephone Number **(479) 784-2331**

Additional Comments if Needed:

Cleanup scheduled

Email a Copy of This Report to the Email Address:

sfloyd@fortsmithar.gov

CONFIRMATION NUMBER

4F29F5E5-34F7-4160-880D-5CDE448BD0F4

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

[Close this window](#) [Print this page](#)

24-Hour Sanitary Sewer Overflow Report

SSO ID#: 4F29F5E5-34F7-4160-880D-5CDE448BD0F4

Date Sent: 3/14/2015

SSO Bypass Upset

Facility Permit Number: **AR0021750**

Date Overflow Began: **3/13/2015**

Date Overflow Ended: **3/14/2015**

Location: **5801 Boys Club Ln. 2001-0754**

Facility name:

Massard WWTP

Time:

12:51 pm

Time:

11:00 am

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

(Enter overflow type if not listed)

Volume: **33,225**

(Give an estimate in gallons)

Impact of SSO Event: **SSO Reached Receiving Water (river,stream)**

Cause of Overflow

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause:

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- Machine rodded Disinfected and Deodorized
- Jet-Vac Hydro Cleaned
- Hand rodded Spread Lime on Affected Area
- Used Generator To Power Pumps/Equipment Public Notification
- Other: Describe

Environmental Damage

- OEHC - Observed or Evidence of Human Contact NEAH - No Evidence of Adverse Health/Environmental Impact
- OEEI - Observed or Evidence of Environmental Impact EFK - Evidence of Fish Kill

Reported By **Steve Floyd** Title **Supt.** Telephone Number **(479) 784-2331**

Additional Comments if Needed:

Cleanup scheduled

Email a Copy of This Report to the Email Address:

sfloyd@fortsmithar.gov

CONFIRMATION NUMBER

9C41D339-9713-4C6A-86F4-B5A6C9480DE5

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

[Close this window](#) [Print this page](#)

24-Hour Sanitary Sewer Overflow Report

SSO ID#: 9C41D339-9713-4C6A-86F4-B5A6C9480DE5

Date Sent: 3/14/2015

SSO Bypass Upset

Facility Permit Number: **AR0033278**

Facility name:

P Street WWTP

Date Overflow Began: **3/13/2015**

Time:

5:04 pm

Date Overflow Ended: **3/14/2015**

Time:

12:00 pm

Location:

3409 Gary Street P009-2250 to 2210

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

(Enter overflow type if not listed)

Volume: 28,400

(Give an estimate in gallons)

Impact of SSO Event: SSO Reached Receiving Water (river, stream)

Cause of Overflow

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause:

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- Machine rodded
- Jet-Vac
- Hand rodded
- Used Generator To Power Pumps/Equipment
- Other: Describe
- Disinfected and Deodorized
- Hydro Cleaned
- Spread Lime on Affected Area
- Public Notification

Environmental Damage

- OEHC - Observed or Evidence of Human Contact
- OEEI - Observed or Evidence of Environmental Impact
- NEAH - No Evidence of Adverse Health/Environmental Impact
- EFK - Evidence of Fish Kill

Reported By **Steve Floyd** Title **Supt.** Telephone Number **(479) 784-2331**

Additional Comments if Needed:

Cleanup scheduled

Email a Copy of This Report to the Email Address:

sfloyd@fortsmithar.gov

CONFIRMATION NUMBER

1F1050FD-28EA-4391-8995-4EEE60A7CEC6

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

[Close this window](#) [Print this page](#)

24-Hour Sanitary Sewer Overflow Report

SSO ID#: 1F1050FD-28EA-4391-8995-4EEE60A7CEC6

Date Sent: 3/14/2015

SSO Bypass Upset

Facility Permit Number: **AR0033278**

Facility name:

P Street WWTP

Date Overflow Began: **3/13/2015**

Time:

12:51 pm

Date Overflow Ended: **3/14/2015**

Time:

10:50 am

Location:

5601 Jenny Lind Rd. MC06-1970

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

(Enter overflow type if not listed)

Volume: **362,725**

(Give an estimate in gallons)

Impact of SSO Event: **SSO Reached Receiving Water (river,stream)**

Cause of Overflow

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause:

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- Machine rodded
- Jet-Vac
- Hand rodded
- Used Generator To Power Pumps/Equipment
- Disinfected and Deodorized
- Hydro Cleaned
- Spread Lime on Affected Area
- Public Notification
- Other: Describe

Environmental Damage

- OEHC - Observed or Evidence of Human Contact
- OEEI - Observed or Evidence of Environmental Impact
- NEAH - No Evidence of Adverse Health/Environmental Impact
- EFK - Evidence of Fish Kill

Reported By **Steve Floyd** Title **Supt.** Telephone Number **(479) 784-2331**

Additional Comments if Needed:

Cleanup scheduled

Email a Copy of This Report to the Email Address:

sfloyd@fortsmithar.gov

CONFIRMATION NUMBER

8D672C4E-BE94-473E-8E77-8C8B46E810F2

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

[Close this window](#) [Print this page](#)

24-Hour Sanitary Sewer Overflow Report

SSO ID#: 8D672C4E-BE94-473E-8E77-8C8B46E810F2

Date Sent: 3/14/2015

SSO Bypass Upset

Facility Permit Number: **AR0021750**

Facility name:

Massacred WWTP

Date Overflow Began: **3/13/2015**

Time:

12:51 pm

Date Overflow Ended: **3/14/2015**

Time:

11:00 am

Location:

5800 Boys Club Ln. 2001-0756/0754

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

(Enter overflow type if not listed)

Volume:

33,225

(Give an estimate in gallons)

Impact of SSO Event:

SSO Reached Receiving Water (river, stream)

Cause of Overflow

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause:

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- Machine rodded
- Jet-Vac
- Hand rodded
- Used Generator To Power Pumps/Equipment
- Disinfected and Deodorized
- Hydro Cleaned
- Spread Lime on Affected Area
- Public Notification

Other: Describe

Environmental Damage

- OEHC - Observed or Evidence of Human Contact
- OEEL - Observed or Evidence of Environmental Impact
- NEAH - No Evidence of Adverse Health/Environmental Impact
- EFK - Evidence of Fish Kill

Reported By **Steve Floyd** Title **Supt.** Telephone Number **(479) 784-2331**

Additional Comments if Needed:

Cleanup scheduled

Email a Copy of This Report to the Email Address:

sfloyd@fortsmithar.gov

CONFIRMATION NUMBER

C2624D1A-0255-4E80-9390-1C2B4E31F54B

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

[Close this window](#) [Print this page](#)

24-Hour Sanitary Sewer Overflow Report

SSO ID#: C2624D1A-0255-4E80-9390-1C2B4E31F54B

Date Sent: 3/12/2015

SSO Bypass Upset

Facility Permit Number: **AR0033278**

Facility name:

P Street

Date Overflow Began: **3/11/2015**

Time:

4:50 pm

Date Overflow Ended: **3/11/2015**

Time:

5:50 pm

Location: **1322 N 8th Street, Manhole P003-0260, yard and storm drain**

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

(Enter overflow type if not listed)

Cause of Overflow

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause:

Volume: **300**

(Give an estimate in gallons)

Impact of SSO Event: **SSO Reached Receiving Water (river,stream)**

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- Machine rodded
- Jet-Vac
- Hand rodded
- Used Generator To Power Pumps/Equipment
- Other: Describe
- Disinfected and Deodorized
- Hydro Cleaned
- Spread Lime on Affected Area
- Public Notification

Environmental Damage

- OEHC - Observed or Evidence of Human Contact
- OE EI - Observed or Evidence of Environmental Impact
- NEAH - No Evidence of Adverse Health/Environmental Impact
- EFK - Evidence of Fish Kill

Reported By **Jimmie B. Johnson**

Title **Superintendent**

Telephone Number **(479) 784-2231**

Additional Comments if Needed:

Email a Copy of This Report to the Email Address:

fjohnson@fsark.com

CONFIRMATION NUMBER

0CECA4A6-0BBC-4C59-B4E2-AB2C58380FE9

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

[Close this window](#) [Print this page](#)

24-Hour Sanitary Sewer Overflow Report

SSO ID#: 0CECA4A6-0BBC-4C59-B4E2-AB2C58380FE9

Date Sent: 3/14/2015

SSO Bypass Upset

Facility Permit Number:

AR0033278

Facility name:

P Street WWTP

Date Overflow Began:

3/13/2015

Time:

11:39 am

Date Overflow Ended:

3/14/2015

Time:

11:35 am

Location:

1412 Phoenix Ave MC06-0305

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

(Enter overflow type if not listed)

Volume:

138,500

(Give an estimate in gallons)

Impact of SSO Event:

SSO Reached Receiving Water (river,stream)

Cause of Overflow

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause:

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- Machine rodded
- Jet-Vac
- Hand rodded
- Used Generator To Power Pumps/Equipment
- Other: Describe
- Disinfected and Deodorized
- Hydro Cleaned
- Spread Lime on Affected Area
- Public Notification

Environmental Damage

- OEHC - Observed or Evidence of Human Contact
- OEEI - Observed or Evidence of Environmental Impact
- NEAH - No Evidence of Adverse Health/Environmental Impact
- EFK - Evidence of Fish Kill

Reported By **Steve Floyd** Title **Supt.** Telephone Number **(479) 784-2331**

Additional Comments if Needed:

Cleanup scheduled

Email a Copy of This Report to the Email Address:

sfloyd@fortsmithar.gov

CONFIRMATION NUMBER

4D0F6C65-17B8-41E6-989B-09F2CAB87707

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

[Close this window](#) [Print this page](#)

24-Hour Sanitary Sewer Overflow Report

SSO ID#: 4D0F6C65-17B8-41E6-989B-09F2CAB87707
Date Sent: 3/11/2015

SSO Bypass Upset

Facility Permit Number: AR0033278
Date Overflow Began: 3/10/2015
Date Overflow Ended: 3/10/2015

Facility name:
Time:
Time:

P Street
5:10 pm
7:00 pm

Location: 2700 Houston Street, Manhole MC05-2500, stormdrain

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

(Enter overflow type if not listed)

Volume: 1100

(Give an estimate in gallons)

Impact of SSO Event: SSO Reached Receiving Water (river,stream)

Cause of Overflow

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause:

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- Machine rodded Disinfected and Deodorized
- Jet-Vac Hydro Cleaned
- Hand rodded Spread Lime on Affected Area
- Used Generator To Power Pumps/Equipment Public Notification
- Other: Describe

Environmental Damage

- OEHC - Observed or Evidence of Human Contact NEAH - No Evidence of Adverse Health/Environmental Impact
- OEEI - Observed or Evidence of Environmental Impact EFK - Evidence of Fish Kill

Reported By **Jimmie B. Johnson**

Title **Superintendent**

Telephone Number **(479) 784-2231**

Additional Comments if Needed:

Email a Copy of This Report to the Email Address:

jjohnson@fsark.com

CONFIRMATION NUMBER

7DED07A3-1273-4AC3-B698-0A76D7A9AE3F

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

[Close this window](#) [Print this page](#)

24-Hour Sanitary Sewer Overflow Report

SSO ID#: 7DED07A3-1273-4AC3-B698-0A76D7A9AE3F
Date Sent: 3/12/2015

SSO Bypass Upset

Facility Permit Number: AR0033278
Date Overflow Began: 3/11/2015
Date Overflow Ended: 3/11/2015
Location:

Facility name:
Time:
Time:

P Street
11:30 am
12:20 pm

3611 Cliff Drive, manhole MC07-1420, ditch

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

(Enter overflow type if not listed)

Volume: 50

(Give an estimate in gallons)

Impact of SSO Event: SSO Reached Receiving Water (river,stream)

Cause of Overflow

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause:

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- Machine rodded
- Jet-Vac
- Hand rodded
- Used Generator To Power Pumps/Equipment
- Other: Describe
- Disinfected and Deodorized
- Hydro Cleaned
- Spread Lime on Affected Area
- Public Notification

Environmental Damage

- OEHC - Observed or Evidence of Human Contact
- OEEI - Observed or Evidence of Environmental Impact
- NEAH - No Evidence of Adverse Health/Environmental Impact
- EFK - Evidence of Fish Kill

Reported By **Jimmie B. Johnson**

Title **Superintendent**

Telephone Number **(479) 784-2231**

Additional Comments if Needed:

Email a Copy of This Report to the Email Address:
jjohnson@fsark.com

CONFIRMATION NUMBER

E6C313DC-A318-4189-8CAF-B98A9C6DC513

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

[Close this window](#) [Print this page](#)

24-Hour Sanitary Sewer Overflow Report

SSO ID#: E6C313DC-A318-4189-8CAF-B98A9C6DC513

Date Sent: 3/11/2015

SSO Bypass Upset

Facility Permit Number: AR0021750

Date Overflow Began: 3/10/2015

Date Overflow Ended: 3/10/2015

Location:

Facility name:

Time:

Time:

Massard

8:00 am

9:28 am

3409 Gary Street, between manholes P009-2270 and P009-2250, yard

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

(Enter overflow type if not listed)

Volume:

88

(Give an estimate in gallons)

Impact of SSO Event:

SSO Affected Private Property (ground)

Cause of Overflow

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause:

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- Machine rodded
- Jet-Vac
- Hand rodded
- Used Generator To Power Pumps/Equipment
- Other: Describe
- Disinfected and Deodorized
- Hydro Cleaned
- Spread Lime on Affected Area
- Public Notification

by-pass pumping

Environmental Damage

- OEHC - Observed or Evidence of Human Contact
- OEEL - Observed or Evidence of Environmental Impact
- NEAH - No Evidence of Adverse Health/Environmental Impact
- EFK - Evidence of Fish Kill

Reported By **Jimmie B. Johnson**

Title **Superintendent**

Telephone Number **(479) 784-2231**

Additional Comments if Needed:

By-pass pumping around a collapsed line has been ongoing for some time, however, the saturated ground from the recent snow melt combined with the rain of the past few days has produced additional flow within the sewer and decreased the storage time between pumping. Our crews have adjusted the pumping schedule accordingly. We are about to bid an emergency sewer repair project which will correct the line failure.

Email a Copy of This Report to the Email Address:

jjohnson@fsark.com

CONFIRMATION NUMBER

CE250315-FC26-40D9-9AA1-1079BA11336A

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

[Close this window](#) [Print this page](#)

24-Hour Sanitary Sewer Overflow Report

SSO ID#: CE250315-FC26-40D9-9AA1-1079BA11336A

Date Sent: 3/11/2015

SSO Bypass Upset

Facility Permit Number:	AR0021750	Facility name:	Massard
Date Overflow Began:	3/10/2015	Time:	11:23 am
Date Overflow Ended:	3/10/2015	Time:	1:10 pm
Location:	3428 Armour Avenue, Between manholes S008-2240 and S008-2140, yard		

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

(Enter overflow type if not listed)

Volume: **107**

(Give an estimate in gallons)

Impact of SSO Event: **SSO Affected Private Property (ground)**

Cause of Overflow

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause:

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- | | |
|--|---|
| <input type="checkbox"/> Machine rodded | <input type="checkbox"/> Disinfected and Deodorized |
| <input checked="" type="checkbox"/> Jet-Vac | <input type="checkbox"/> Hydro Cleaned |
| <input type="checkbox"/> Hand rodded | <input type="checkbox"/> Spread Lime on Affected Area |
| <input type="checkbox"/> Used Generator To Power Pumps/Equipment | <input type="checkbox"/> Public Notification |
| <input type="checkbox"/> Other: Describe | |

Environmental Damage

- | | |
|---|---|
| <input type="checkbox"/> OEHC - Observed or Evidence of Human Contact | <input checked="" type="checkbox"/> NEAH - No Evidence of Adverse Health/Environmental Impact |
| <input type="checkbox"/> OE EI - Observed or Evidence of Environmental Impact | <input type="checkbox"/> EFK - Evidence of Fish Kill |

Reported By **Jimmie B. Johnson**

Title **Superintendent**

Telephone Number **(479) 784-2231**

Additional Comments if Needed:

Email a Copy of This Report to the Email Address:
jjohnson@fsark.com

CONFIRMATION NUMBER

C481A64C-ED6A-4E54-9C4E-BDF9085B2BEA

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

Close this window Print this page

24-Hour Sanitary Sewer Overflow Report

SSO ID#: C481A64C-ED6A-4E54-9C4E-BDF9085B2BEA

Date Sent: 3/11/2015

SSO Bypass Upset

Facility Permit Number: AR0021750

Date Overflow Began: 3/10/2015

Date Overflow Ended: 3/10/2015

Location:

Facility name:

Time:

Time:

Massard

6:50 pm

8:00 pm

4109 Morris, between manholes S007-0500 and S007-0490, Storm Drain

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
 Lift Station Overflow
 Main Line Overflow
 Service Line Overflow
 Other Overflow Type:

(Enter overflow type if not listed)

Cause of Overflow

- I & I - Rainfall
 Roots
 Grease
 Debris
 Equipment Failure
 Construction
 Vandalism
 Power Failure
 Line Failure/Break
 Other Cause:

Volume: 1100

(Give an estimate in gallons)

Impact of SSO Event: SSO Reached Receiving Water (river,stream)

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- Machine rodded Disinfected and Deodorized
 Jet-Vac Hydro Cleaned
 Hand rodded Spread Lime on Affected Area
 Used Generator To Power Pumps/Equipment Public Notification
 Other: Describe

Environmental Damage

- OEHC - Observed or Evidence of Human Contact NEAH - No Evidence of Adverse Health/Environmental Impact
 OEEI - Observed or Evidence of Environmental Impact EFK - Evidence of Fish Kill

Reported By Jimmie B. Johnson

Title Superintendent

Telephone Number (479) 784-2231

Additional Comments if Needed:

Email a Copy of This Report to the Email Address:

jjohnson@fsark.com

24-Hour Sanitary Sewer Overflow Report

SSO ID#: 64FFE17E-BBC4-44B6-8D1C-92703ADBB766

Date Sent: 3/11/2015

SSO Bypass Upset

Facility Permit Number: **AR0021750**

Facility name:

Massard

Date Overflow Began: **3/10/2015**

Time:

8:00 am

Date Overflow Ended: **3/10/2015**

Time:

10:50 am

Location:

4619 South Q Street, between manholes S003-1665 and S003-1650

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

(Enter overflow type if not listed)

Volume:

1700

(Give an estimate in gallons)

Impact of SSO Event:

SSO Reached Receiving Water (river,stream)

Cause of Overflow

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause:

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- Machine rodded
- Jet-Vac
- Hand rodded
- Used Generator To Power Pumps/Equipment
- Other: Describe
- Disinfected and Deodorized
- Hydro Cleaned
- Spread Lime on Affected Area
- Public Notification

Environmental Damage

- OEHC - Observed or Evidence of Human Contact
- NEAH - No Evidence of Adverse Health/Environmental Impact
- OEEI - Observed or Evidence of Environmental Impact
- EFK - Evidence of Fish Kill

Reported By **Jimmie B. Johnson**

Title **Superintendent**

Telephone Number **(479) 784-2231**

Additional Comments if Needed:

Email a Copy of This Report to the Email Address:

jjohnson@fsark.com

CONFIRMATION NUMBER

FFC53D4F-FAA2-49A3-903F-16302817528D

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

[Close this window](#) [Print this page](#)

24-Hour Sanitary Sewer Overflow Report

SSO ID#: FFC53D4F-FAA2-49A3-903F-16302817528D

Date Sent: 3/10/2015

SSO Bypass Upset

Facility Permit Number: **AR0033278**

Date Overflow Began: **3/10/2015**

Date Overflow Ended: **3/10/2015**

Location:

Facility name:

Time:

Time:

P Street

9:00 am

9:30 am

3226 Iola Street, between manholes 2003-0800 and 2003-0790, yard

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

(Enter overflow type if not listed)

Volume: 375

(Give an estimate in gallons)

Impact of SSO Event: SSO Affected Private Property (ground)

Cause of Overflow

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause:

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- Machine rodded
- Jet-Vac
- Hand rodded
- Used Generator To Power Pumps/Equipment
- Other: Describe
- Disinfected and Deodorized
- Hydro Cleaned
- Spread Lime on Affected Area
- Public Notification

Environmental Damage

- OEHC - Observed or Evidence of Human Contact
- OEEI - Observed or Evidence of Environmental Impact
- NEAH - No Evidence of Adverse Health/Environmental Impact
- EFK - Evidence of Fish Kill

Reported By **Jimmie B. Johnson**

Title **Superintendent**

Telephone Number **(479) 784-2231**

Additional Comments if Needed:

[Empty box for additional comments]

Email a Copy of This Report to the Email Address:

jjohnson@fsark.com

CONFIRMATION NUMBER

10E6A872-4AA9-40CB-85E7-C9CD742269D0

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

[Close this window](#) [Print this page](#)

24-Hour Sanitary Sewer Overflow Report

SSO ID#: 10E6A872-4AA9-40CB-85E7-C9CD742269D0
Date Sent: 3/11/2015

SSO Bypass Upset

Facility Permit Number:	AR0021750	Facility name:	Massard
Date Overflow Began:	3/10/2015	Time:	8:40 am
Date Overflow Ended:	3/10/2015	Time:	9:40 am
Location:	4209 Jennylind Road, between manholes MC05-0640 and MC05-0630, ditch		

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

(Enter overflow type if not listed)

Volume: **60**

(Give an estimate in gallons)

Impact of SSO Event: **SSO Affected Private Property (ground)**

Cause of Overflow

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause:

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- | | |
|--|---|
| <input type="checkbox"/> Machine rodded | <input type="checkbox"/> Disinfected and Deodorized |
| <input checked="" type="checkbox"/> Jet-Vac | <input type="checkbox"/> Hydro Cleaned |
| <input type="checkbox"/> Hand rodded | <input type="checkbox"/> Spread Lime on Affected Area |
| <input type="checkbox"/> Used Generator To Power Pumps/Equipment | <input type="checkbox"/> Public Notification |
| <input type="checkbox"/> Other: Describe | |

Environmental Damage

- | | |
|--|---|
| <input type="checkbox"/> OEHC - Observed or Evidence of Human Contact | <input checked="" type="checkbox"/> NEAH - No Evidence of Adverse Health/Environmental Impact |
| <input type="checkbox"/> OEEI - Observed or Evidence of Environmental Impact | <input type="checkbox"/> EFK - Evidence of Fish Kill |

Reported By **Jimmie B. Johnson**

Title **Superintendent**

Telephone Number **(479) 784-2231**

Additional Comments if Needed:

Email a Copy of This Report to the Email Address:

jjohnson@fsark.com

CONFIRMATION NUMBER

9ABB93E2-6688-461C-A77A-BDFEE6A3940

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

[Close this window](#) [Print this page](#)

24-Hour Sanitary Sewer Overflow Report

SSO ID#: 9ABB93E2-6688-461C-A77A-BDFEE6A3940

Date Sent: 3/10/2015

SSO Bypass Upset

Facility Permit Number:	AR0021750	Facility name:	Massard
Date Overflow Began:	3/9/2015	Time:	2:50 pm
Date Overflow Ended:	3/9/2015	Time:	4:30 pm
Location:	2001 Chruchill Road, Manhole S007-0590, yard		

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow		Cause of Overflow	
<input checked="" type="checkbox"/> Manhole Overflow		<input checked="" type="checkbox"/> I & I - Rainfall	
<input type="checkbox"/> Lift Station Overflow		<input type="checkbox"/> Roots	
<input type="checkbox"/> Main Line Overflow		<input checked="" type="checkbox"/> Grease	
<input type="checkbox"/> Service Line Overflow		<input type="checkbox"/> Debris	
<input type="checkbox"/> Other Overflow Type:		<input type="checkbox"/> Equipment Failure	
	(Enter overflow type if not listed)	<input type="checkbox"/> Construction	
Volume:	900	<input type="checkbox"/> Vandalism	
	(Give an estimate in gallons)	<input type="checkbox"/> Power Failure	
Impact of SSO Event:	SSO Affected Private Property (ground)	<input type="checkbox"/> Line Failure/Break	
		<input type="checkbox"/> Other Cause:	

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

<input type="checkbox"/> Machine rodded	<input type="checkbox"/> Disinfected and Deodorized
<input checked="" type="checkbox"/> Jet-Vac	<input type="checkbox"/> Hydro Cleaned
<input type="checkbox"/> Hand rodded	<input type="checkbox"/> Spread Lime on Affected Area
<input type="checkbox"/> Used Generator To Power Pumps/Equipment	<input type="checkbox"/> Public Notification
<input type="checkbox"/> Other: Describe	

Environmental Damage

OEHC - Observed or Evidence of Human Contact NEAH - No Evidence of Adverse Health/Environmental Impact
 OEEI - Observed or Evidence of Environmental Impact EFK - Evidence of Fish Kill

Reported By **Jimmie B. Johnson**

Title **Superintendent**

Telephone Number **(479) 784-2231**

Additional Comments if Needed:

Email a Copy of This Report to the Email Address:
jjohnson@fsark.com

CONFIRMATION NUMBER

D42538DB-6D41-416B-9F8B-BEC3D8759BD9

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

[Close this window](#) [Print this page](#)

24-Hour Sanitary Sewer Overflow Report

SSO ID#: D42538DB-6D41-416B-9F8B-BEC3D8759BD9

Date Sent: 3/11/2015

SSO Bypass Upset

Facility Permit Number: **AR0033278**

Date Overflow Began: **3/10/2015**

Date Overflow Ended: **3/10/2015**

Location:

Facility name:

Time:

Time:

P Street

8:30 am

8:50 am

1319 South 17th Street, between manholes P006-0380 and P006-0340, yard

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

(Enter overflow type if not listed)

Volume:

500

(Give an estimate in gallons)

Impact of SSO Event:

SSO Affected Private Property (ground)

Cause of Overflow

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause:

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- Machine rodded
- Jet-Vac
- Hand rodded
- Used Generator To Power Pumps/Equipment
- Other: Describe
- Disinfected and Deodorized
- Hydro Cleaned
- Spread Lime on Affected Area
- Public Notification

Environmental Damage

- OEHC - Observed or Evidence of Human Contact
- OEI - Observed or Evidence of Environmental Impact
- NEAH - No Evidence of Adverse Health/Environmental Impact
- EFK - Evidence of Fish Kill

Reported By **Jimmie B. Johnson**

Title **Superintendent**

Telephone Number **(479) 784-2231**

Additional Comments if Needed:

Email a Copy of This Report to the Email Address:
jjohnson@fsark.com

CONFIRMATION NUMBER

3605E7FC-08FB-4A65-B087-B71AD8C93ACA

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

[Close this window](#) [Print this page](#)

24-Hour Sanitary Sewer Overflow Report

SSO ID#: 3605E7FC-08FB-4A65-B087-B71AD8C93ACA
Date Sent: 3/9/2015

SSO Bypass Upset

Facility Permit Number:	AR0021750	Facility name:	Massard
Date Overflow Began:	3/8/2015	Time:	4:16 pm
Date Overflow Ended:	3/8/2015	Time:	7:49 pm
Location:	5424 Park Avenue, between manholes S003-3670 and S003-3660, building		

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

(Enter overflow type if not listed)

Volume: **213**

(Give an estimate in gallons)

Impact of SSO Event: **Basement Backup**

Cause of Overflow

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause:

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- | | |
|--|---|
| <input type="checkbox"/> Machine rodded | <input type="checkbox"/> Disinfected and Deodorized |
| <input checked="" type="checkbox"/> Jet-Vac | <input type="checkbox"/> Hydro Cleaned |
| <input type="checkbox"/> Hand rodded | <input type="checkbox"/> Spread Lime on Affected Area |
| <input type="checkbox"/> Used Generator To Power Pumps/Equipment | <input type="checkbox"/> Public Notification |
| <input type="checkbox"/> Other: Describe | |

Environmental Damage

- | | |
|--|---|
| <input type="checkbox"/> OEHC - Observed or Evidence of Human Contact | <input checked="" type="checkbox"/> NEAH - No Evidence of Adverse Health/Environmental Impact |
| <input type="checkbox"/> OEEI - Observed or Evidence of Environmental Impact | <input type="checkbox"/> EFK - Evidence of Fish Kill |

Reported By **Jimmie B. Johnson**

Title, **Superintendent**

Telephone Number **(479) 784-2231**

Additional Comments if Needed:

Email a Copy of This Report to the Email Address:
jjohnson@fsark.com

CONFIRMATION NUMBER

002AC10C-A683-4959-B5D3-07EFDD7F69FF

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

[Close this window](#) [Print this page](#)

24-Hour Sanitary Sewer Overflow Report

SSO ID#: 002AC10C-A683-4959-B5D3-07EFDD7F69FF
Date Sent: 3/9/2015

SSO Bypass Upset

Facility Permit Number: **AR0021750**

Date Overflow Began: **3/8/2015**

Date Overflow Ended: **3/8/2015**

Location:

Facility name:

Time:

Time:

Massard

5:40 pm

5:40 pm

7107 South R Street, between manholes RL01-0850 and RL01-0843, building

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

(Enter overflow type if not listed)

Volume:

unknown

(Give an estimate in gallons)

Impact of SSO Event:

Basement Backup

Cause of Overflow

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause: **unknown**

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- Machine rodded
- Jet-Vac
- Hand rodded
- Used Generator To Power Pumps/Equipment
- Other: Describe **none**
- Disinfected and Deodorized
- Hydro Cleaned
- Spread Lime on Affected Area
- Public Notification

Environmental Damage

- OEHC - Observed or Evidence of Human Contact
- OEEI - Observed or Evidence of Environmental Impact
- NEAH - No Evidence of Adverse Health/Environmental Impact
- EFK - Evidence of Fish Kill

Reported By **Jimmie B. Johnson**

Title **Superintendent**

Telephone Number **(479) 784-2231**

Additional Comments if Needed:

Overflow occurred between October 5th and March 8th while residents were gone on vacation.

Email a Copy of This Report to the Email Address:

jjohnson@fsark.com

CONFIRMATION NUMBER

5447B5C1-AFFE-484C-9CBF-E04E05A6C57D

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

[Close this window](#) [Print this page](#)

24-Hour Sanitary Sewer Overflow Report

SSO ID#: 5447B5C1-AFFE-484C-9CBF-E04E05A6C57D

Date Sent: 3/9/2015

SSO Bypass Upset

Facility Permit Number: AR0033278

Date Overflow Began: 3/8/2015

Date Overflow Ended: 3/8/2015

Location:

Facility name:

Time:

Time:

P Street

3:04 pm

6:08 pm

2701 Glen Flora Way, Manhole 2005-0340, yard

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

(Enter overflow type if not listed)

Cause of Overflow

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause:

Volume: 184

(Give an estimate in gallons)

Impact of SSO Event: SSO Affected Private Property (ground)

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- Machine rodded
- Jet-Vac
- Hand rodded
- Used Generator To Power Pumps/Equipment
- Other: Describe
- Disinfected and Deodorized
- Hydro Cleaned
- Spread Lime on Affected Area
- Public Notification

Environmental Damage

- OEHC - Observed or Evidence of Human Contact
- OEEI - Observed or Evidence of Environmental Impact
- NEAH - No Evidence of Adverse Health/Environmental Impact
- EFK - Evidence of Fish Kill

Reported By Jimmie B. Johnson

Title Superintendent

Telephone Number (479) 784-2231

Additional Comments if Needed:

Email a Copy of This Report to the Email Address:
jjohnson@fsark.com

CONFIRMATION NUMBER

B20D8E0F-635A-4AD6-85E9-1F5193B504EE

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

[Close this window](#) [Print this page](#)

24-Hour Sanitary Sewer Overflow Report

SSO ID#: B20D8E0F-635A-4AD6-85E9-1F5193B504EE

Date Sent: 3/6/2015

SSO Bypass Upset

Facility Permit Number: **AR0021750**

Facility name:

Massard WWTP

Date Overflow Began: **3/6/2015**

Time:

5:12 pm

Date Overflow Ended: **3-6-2015**

Time:

6:02 pm

Location:

3602 Morris Drive S001-0760 to 0750 Service line clean out overflow

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

(Enter overflow type if not listed)

Volume: **50**

(Give an estimate in gallons)

Impact of SSO Event: **SSO Affected Private Property (ground)**

Cause of Overflow

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause:

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- Machine rodded Disinfected and Deodorized
- Jet-Vac Hydro Cleaned
- Hand rodded Spread Lime on Affected Area
- Used Generator To Power Pumps/Equipment Public Notification
- Other: Describe

Environmental Damage

- OEHC - Observed or Evidence of Human Contact NEAH - No Evidence of Adverse Health/Environmental Impact
- OEEI - Observed or Evidence of Environmental Impact EFK - Evidence of Fish Kill

Reported By **Steve Floyd** Title **Supt.** Telephone Number **(479) 784-2331**

Additional Comments if Needed:

Cleanup scheduled.

Email a Copy of This Report to the Email Address:

Sfloyd@fortsmithar.gov

CONFIRMATION NUMBER

C88693FF-32D8-4691-8DA0-53210B544CBD

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

[Close this window](#) [Print this page](#)

24-Hour Sanitary Sewer Overflow Report

SSO ID#: C88693FF-32D8-4691-8DA0-53210B544CBD

Date Sent: 3/6/2015

SSO Bypass Upset

Facility Permit Number: **AR0033278**

Facility name:

P Street

Date Overflow Began: **3/5/2015**

Time:

1:18 pm

Date Overflow Ended: **3/5/2015**

Time:

5:15 pm

Location: **1438 Belle Avenue, cleanout between manholes P005-0230 and P005-0220, yard**

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

(Enter overflow type if not listed)

Volume:

1265

(Give an estimate in gallons)

Impact of SSO Event:

SSO Affected Private Property (ground)

Cause of Overflow

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause:

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- Machine rodded
- Jet-Vac
- Hand rodded
- Used Generator To Power Pumps/Equipment
- Other: Describe
- Disinfected and Deodorized
- Hydro Cleaned
- Spread Lime on Affected Area
- Public Notification

Environmental Damage

- OEHC - Observed or Evidence of Human Contact
- OEEL - Observed or Evidence of Environmental Impact
- NEAH - No Evidence of Adverse Health/Environmental Impact
- EFK - Evidence of Fish Kill

Reported By **Jimmie B. Johnson**

Title **Superintendent**

Telephone Number **(479) 784-2231**

Additional Comments if Needed:

Email a Copy of This Report to the Email Address:

jjohnson@fsark.com

CONFIRMATION NUMBER

DE913D52-8C7F-4049-9AAE-000360975E26

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

[Close this window](#) [Print this page](#)

24-Hour Sanitary Sewer Overflow Report

SSO ID#: DE913D52-8C7F-4049-9AAE-000360975E26

Date Sent: 3/6/2015

SSO Bypass Upset

Facility Permit Number:

AR0033278

Facility name:

P Street WWTP

Date Overflow Began:

3/6/2015

Time:

10:19 am

Date Overflow Ended:

3/6/2015

Time:

11:50 am

Location:

**1319 South 17th Street P006-0380 to 0345
Service line clean out overflow.**

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

(Enter overflow type if not listed)

Volume:

1065

(Give an estimate in gallons)

Impact of SSO Event:

SSO Affected Private Property (ground)

Cause of Overflow

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause:

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- Machine rodded
- Jet-Vac
- Hand rodded
- Used Generator To Power Pumps/Equipment
- Other: Describe
- Disinfected and Deodorized
- Hydro Cleaned
- Spread Lime on Affected Area
- Public Notification

Environmental Damage

- OEHC - Observed or Evidence of Human Contact
- OEEI - Observed or Evidence of Environmental Impact
- NEAH - No Evidence of Adverse Health/Environmental Impact
- EFK - Evidence of Fish Kill

Reported By **Steve Floyd** Title **Supt.** Telephone Number **(479) 784-2331**

Additional Comments if Needed:

Cleanup scheduled

Email a Copy of This Report to the Email Address:

Sfloyd@fortsmithar.gov

CONFIRMATION NUMBER

929CDD57-2AA7-4ED1-9EF6-47EAC862EF42

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

[Close this window](#) [Print this page](#)

24-Hour Sanitary Sewer Overflow Report

SSO ID#: 929CDD57-2AA7-4ED1-9EF6-47EAC862EF42
Date Sent: 3/5/2015

SSO Bypass Upset

Facility Permit Number: AR0021750
Date Overflow Began: 3/4/2015
Date Overflow Ended: 3/5/2015
Location:

Facility name:
Time:
Time:

Massard
3:00 pm
10:40 am

3200 Vicksburg, Manhole M002-1400, storm drain

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

Cause of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause:

(Enter overflow type if not listed)

Volume: 41300

(Give an estimate in gallons)

Impact of SSO Event: SSO Reached Receiving Water (river,stream)

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- Machine rodded
- Jet-Vac
- Hand rodded
- Used Generator To Power Pumps/Equipment
- Other: Describe
- Disinfected and Deodorized
- Hydro Cleaned
- Spread Lime on Affected Area
- Public Notification

Environmental Damage

- OEHC - Observed or Evidence of Human Contact
- OEI - Observed or Evidence of Environmental Impact
- NEAH - No Evidence of Adverse Health/Environmental Impact
- EFK - Evidence of Fish Kill

Reported By Jimmie B. Johnson

Title Superintendent

Telephone Number (479) 784-2231

Additional Comments if Needed:

[Empty box for additional comments]

Email a Copy of This Report to the Email Address:
jjohnson@fsark.com

CONFIRMATION NUMBER

EB74D942-DEDD-4B77-8DEC-04FB062F2082

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

[Close this window](#) [Print this page](#)

24-Hour Sanitary Sewer Overflow Report

SSO ID#: EB74D942-DEDD-4B77-8DEC-04FB062F2082

Date Sent: 3/5/2015

SSO Bypass Upset

Facility Permit Number: **AR0033278**

Date Overflow Began: **3/4/2015**

Date Overflow Ended: **3/4/2015**

Location:

Facility name:

Time:

Time:

P Street

3:30 pm

4:45 pm

3811 Dallas Street, Clean out between Manholes P009-2390 and P009-2330, yard

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

(Enter overflow type if not listed)

Volume:

550

(Give an estimate in gallons)

Impact of SSO Event:

SSO Affected Private Property (ground)

Cause of Overflow

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause:

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- Machine rodded
- Disinfected and Deodorized
- Jet-Vac
- Hydro Cleaned
- Hand rodded
- Spread Lime on Affected Area
- Used Generator To Power Pumps/Equipment
- Public Notification
- Other: Describe

Environmental Damage

- OEHC - Observed or Evidence of Human Contact
- NEAH - No Evidence of Adverse Health/Environmental Impact
- OEEI - Observed or Evidence of Environmental Impact
- EFK - Evidence of Fish Kill

Reported By **Jimmie B. Johnson**

Title **Superintendent**

Telephone Number **(479) 784-2231**

Additional Comments if Needed:

Email a Copy of This Report to the Email Address:
jjohnson@fsark.com

CONFIRMATION NUMBER

CBAFEACC-967A-4BC8-910E-E32D0D5AEDB1

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

[Close this window](#) [Print this page](#)

24-Hour Sanitary Sewer Overflow Report

SSO ID#: CBAFEACC-967A-4BC8-910E-E32D0D5AEDB1

Date Sent: 3/5/2015

SSO Bypass Upset

Facility Permit Number: **AR0021750**

Facility name:

Massard

Date Overflow Began: **3/4/2015**

Time:

7:15 pm

Date Overflow Ended: **3/4/2015**

Time:

9:45 pm

Location: **2001 Churchhill Road, Manhole S007-0590, yard**

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

(Enter overflow type if not listed)

Volume:

1350

(Give an estimate in gallons)

Impact of SSO Event:

SSO Affected Private Property (ground)

Cause of Overflow

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause:

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- Machine rodded
- Jet-Vac
- Hand rodded
- Used Generator To Power Pumps/Equipment
- Other: Describe
- Disinfected and Deodorized
- Hydro Cleaned
- Spread Lime on Affected Area
- Public Notification

Environmental Damage

- OEHC - Observed or Evidence of Human Contact
- OEEI - Observed or Evidence of Environmental Impact
- NEAH - No Evidence of Adverse Health/Environmental Impact
- EFK - Evidence of Fish Kill

Reported By **Jimmie B. Johnson**

Title **Superintendent**

Telephone Number **(479) 784-2231**

Additional Comments if Needed:

Email a Copy of This Report to the Email Address:

jjohnson@fsark.com

CONFIRMATION NUMBER

DFA049EB-71DC-444D-804B-5B1C4655DE7D

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

[Close this window](#) [Print this page](#)

24-Hour Sanitary Sewer Overflow Report

SSO ID#: DFA049EB-71DC-444D-804B-5B1C4655DE7D

Date Sent: 3/5/2015

SSO Bypass Upset

Facility Permit Number: **AR0021750**

Facility name:

Massard

Date Overflow Began: **3/4/2015**

Time:

12:30 pm

Date Overflow Ended: **3/5/2015**

Time:

10:28 am

Location:

9422 Rogers Avenue, Manhole M002-0070, creek

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

(Enter overflow type if not listed)

Volume:

197700

(Give an estimate in gallons)

Impact of SSO Event:

SSO Reached Receiving Water (river,stream)

Cause of Overflow

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause:

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- Machine rodded
- Jet-Vac
- Hand rodded
- Used Generator To Power Pumps/Equipment
- Other: Describe
- Disinfected and Deodorized
- Hydro Cleaned
- Spread Lime on Affected Area
- Public Notification

Environmental Damage

- OEHC - Observed or Evidence of Human Contact
- OEEL - Observed or Evidence of Environmental Impact
- NEAH - No Evidence of Adverse Health/Environmental Impact
- EFK - Evidence of Fish Kill

Reported By **Jimmie B. Johnson**

Title **Superintendent**

Telephone Number **(479) 784-2231**

Additional Comments if Needed:

Email a Copy of This Report to the Email Address:

jjohnson@fsark.com

CONFIRMATION NUMBER

B95F2B03-AA4B-4483-9775-D43A1B79BFFF

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

[Close this window](#) [Print this page](#)

24-Hour Sanitary Sewer Overflow Report

SSO ID#: B95F2B03-AA4B-4483-9775-D43A1B79BFFF
Date Sent: 3/5/2015

SSO Bypass Upset

Facility Permit Number:	AR0033278	Facility name:	P Street
Date Overflow Began:	3/4/2015	Time:	1:00 pm
Date Overflow Ended:	3/5/2015	Time:	10:45 am
Location:	1412 Pheonix Avenue, Manhole MC06-0305, storm drain		

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

(Enter overflow type if not listed)

Volume: **361625**

(Give an estimate in gallons)

Impact of SSO Event: **SSO Reached Receiving Water (river,stream)**

Cause of Overflow

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandallism
- Power Failure
- Line Failure/Break
- Other Cause:

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- | | |
|--|---|
| <input type="checkbox"/> Machine rodded | <input type="checkbox"/> Disinfected and Deodorized |
| <input type="checkbox"/> Jet-Vac | <input type="checkbox"/> Hydro Cleaned |
| <input type="checkbox"/> Hand rodded | <input type="checkbox"/> Spread Lime on Affected Area |
| <input type="checkbox"/> Used Generator To Power Pumps/Equipment | <input type="checkbox"/> Public Notification |
| <input type="checkbox"/> Other: Describe | |

Environmental Damage

- OEHC - Observed or Evidence of Human Contact NEAH - No Evidence of Adverse Health/Environmental Impact
- OEEI - Observed or Evidence of Environmental Impact EFK - Evidence of Fish Kill

Reported By **Jimmie B. Johnson**

Title **Superintendent**

Telephone Number **(479) 784-2231**

Additional Comments if Needed:

Email a Copy of This Report to the Email Address:
jjohnson@fsark.com

CONFIRMATION NUMBER

E1068164-EFD6-4940-B752-DA37FD3EB483

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

Close this window Print this page

24-Hour Sanitary Sewer Overflow Report

SSO ID#: E1068164-EFD6-4940-B752-DA37FD3EB483

Date Sent: 3/5/2015

SSO Bypass Upset

Facility Permit Number: AR0033278

Facility name:

P Street

Date Overflow Began: 3/4/2015

Time:

5:45 pm

Date Overflow Ended: 3/5/2015

Time:

11:14 am

Location:

4131 Stanard Street, Manhole P007-1990, paved area

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

(Enter overflow type if not listed)

Volume: 10490

(Give an estimate in gallons)

Impact of SSO Event: SSO Affected Private Property (ground)

Cause of Overflow

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause:

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- Machine rodded
- Jet-Vac
- Hand rodded
- Used Generator To Power Pumps/Equipment
- Other: Describe
- Disinfected and Deodorized
- Hydro Cleaned
- Spread Lime on Affected Area
- Public Notification

Environmental Damage

- OEHC - Observed or Evidence of Human Contact
- OEEI - Observed or Evidence of Environmental Impact
- NEAH - No Evidence of Adverse Health/Environmental Impact
- EFK - Evidence of Fish Kill

Reported By Jimmie B. Johnson

Title Superintendent

Telephone Number (479) 784-2231

Additional Comments if Needed:

Email a Copy of This Report to the Email Address:

jjohnson@fsark.com

CONFIRMATION NUMBER

99672FB2-9421-4A78-BD19-12A2161F2D74

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

[Close this window](#) [Print this page](#)

24-Hour Sanitary Sewer Overflow Report

SSO ID#: 99672FB2-9421-4A78-BD19-12A2161F2D74
Date Sent: 3/4/2015

SSO Bypass Upset

Facility Permit Number: **AR0033278**
Date Overflow Began: **3/4/2015**
Date Overflow Ended: **3/4/2015**
Location: **100 Georgetown Lane, Manhole Z006-0930, yard**

Facility name: **P Street**
Time: **7:20 am**
Time: **8:30 am**

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

(Enter overflow type if not listed)

Cause of Overflow

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause:

Volume: **350**

(Give an estimate in gallons)

Impact of SSO Event: **SSO Affected Private Property (ground)**

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- Machine rodded
- Jet-Vac
- Hand rodded
- Used Generator To Power Pumps/Equipment
- Other: Describe
- Disinfected and Deodorized
- Hydro Cleaned
- Spread Lime on Affected Area
- Public Notification

Environmental Damage

- OEHC - Observed or Evidence of Human Contact
- OEEI - Observed or Evidence of Environmental Impact
- NEAH - No Evidence of Adverse Health/Environmental Impact
- EFK - Evidence of Fish Kill

Reported By **Jimmie B. Johnson**

Title **Superintendent**

Telephone Number **(479) 184-2231**

Additional Comments if Needed:

Email a Copy of This Report to the Email Address:
jjohnson@fsark.com

CONFIRMATION NUMBER

ADDB2E14-D670-4F4D-9716-E0E38A7AEF73

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

[Close this window](#) [Print this page](#)

24-Hour Sanitary Sewer Overflow Report

SSO ID#: ADDB2E14-D670-4F4D-9716-E0E38A7AEF73
Date Sent: 3/5/2015

SSO Bypass Upset

Facility Permit Number: AR0033278
Date Overflow Began: 3/4/2015
Date Overflow Ended: 3/4/2015
Location:

Facility name: P Street
Time: 6:30 pm
Time: 7:00 pm

1417 South 17th Street, between Manholes P006-0390 and P006-0380, Building

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

(Enter overflow type if not listed)

Volume: 300

(Give an estimate in gallons)

Impact of SSO Event: Basement Backup

Cause of Overflow

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause:

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- Machine rodded
- Jet-Vac
- Hand rodded
- Used Generator To Power Pumps/Equipment
- Other: Describe
- Disinfected and Deodorized
- Hydro Cleaned
- Spread Lime on Affected Area
- Public Notification

Environmental Damage

- OEHC - Observed or Evidence of Human Contact
- OEEI - Observed or Evidence of Environmental Impact
- NEAH - No Evidence of Adverse Health/Environmental Impact
- EFK - Evidence of Fish Kill

Reported By **Jimmie B. Johnson**

Title **Superintendent**

Telephone Number **(479) 784-2231**

Additional Comments if Needed:

[Empty box for additional comments]

Email a Copy of This Report to the Email Address:
jjohnson@fsark.com

CONFIRMATION NUMBER

A8127C4E-A07C-484E-9406-FA197085649E

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

[Close this window](#) [Print this page](#)

24-Hour Sanitary Sewer Overflow Report

SSO ID#: A8127C4E-A07C-484E-9406-FA197085649E

Date Sent: 3/3/2015

SSO Bypass Upset

Facility Permit Number: **AR0033278**

Date Overflow Began: **3/2/2015**

Date Overflow Ended: **3/2/2015**

Location:

Facility name:

Time:

Time:

P Street

1:00 pm

3:00 pm

3400 Gary Street, Manhole P009-2270, Storm drain

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

(Enter overflow type if not listed)

Volume: 240

(Give an estimate in gallons)

Impact of SSO Event: SSO Reached Receiving Water (river,stream)

Cause of Overflow

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause:

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- Machine rodded
- Jet-Vac
- Hand rodded
- Used Generator To Power Pumps/Equipment
- Other: Describe
- Disinfected and Deodorized
- Hydro Cleaned
- Spread Lime on Affected Area
- Public Notification

Environmental Damage

- OEHC - Observed or Evidence of Human Contact
- OEEI - Observed or Evidence of Environmental Impact
- NEAH - No Evidence of Adverse Health/Environmental Impact
- EFK - Evidence of Fish Kill

Reported By **Jimmie B. Johnson**

Title **Superintendent**

Telephone Number **(479) 784-2231**

Additional Comments if Needed:

[Empty box for additional comments]

Email a Copy of This Report to the Email Address:

jjohnson@fsark.com

CONFIRMATION NUMBER

B6B861E1-2F80-4F99-80C6-6F7C436ACE8F

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

[Close this window](#) [Print this page](#)

24-Hour Sanitary Sewer Overflow Report

SSO ID#: B6B861E1-2F80-4F99-80C6-6F7C436ACE8F

Date Sent: 3/4/2015

SSO Bypass Upset

Facility Permit Number: **AR0033278**

Facility name:

P Street

Date Overflow Began: **3/4/2015**

Time:

11:30 am

Date Overflow Ended: **3/4/2015**

Time:

12:15 pm

Location:

2414 Independence Street, Clean out between Manholes MC05-1315 and MC05-2310, yard

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

(Enter overflow type if not listed)

Volume: **375**

(Give an estimate in gallons)

Impact of SSO Event:

SSO Affected Private Property (ground)

Cause of Overflow

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause:

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- Machine rodded
- Disinfected and Deodorized
- Jet-Vac
- Hydro Cleaned
- Hand rodded
- Spread Lime on Affected Area
- Used Generator To Power Pumps/Equipment
- Public Notification
- Other: Describe

Environmental Damage

- OEH - Observed or Evidence of Human Contact
- NEAH - No Evidence of Adverse Health/Environmental Impact
- OEEI - Observed or Evidence of Environmental Impact
- EFK - Evidence of Fish Kill

Reported By **Jimmie B. Johnson**

Title **Superintendent**

Telephone Number **(479) 784-2231**

Additional Comments if Needed:

Email a Copy of This Report to the Email Address:

jjohnson@fsark.com

CONFIRMATION NUMBER

68BCF52D-67B6-4064-B2EB-44194DBDD6C1

(NOTE: You will need this number should you ever need to contact ADEQ concerning this report)

The following information has been sent.

[Close this window](#) [Print this page](#)

24-Hour Sanitary Sewer Overflow Report

SSO ID#: 68BCF52D-67B6-4064-B2EB-44194DBDD6C1

Date Sent: 3/3/2015

SSO Bypass Upset

Facility Permit Number: **AR0033278**

Facility name:

P Street

Date Overflow Began: **3/2/2015**

Time:

10:00 am

Date Overflow Ended: **3/2/2015**

Time:

1:15 pm

Location:

3830 Crystal Lane, Manhole FI02-0670, ditch

(Give address, manhole number-if numbered. Include where the overflow went-yard, ditch, stream, storm sewer, building, other).

Type of Overflow

- Manhole Overflow
- Lift Station Overflow
- Main Line Overflow
- Service Line Overflow
- Other Overflow Type:

(Enter overflow type if not listed)

Volume: 975

(Give an estimate in gallons)

Impact of SSO Event: SSO Affected Private Property (ground)

Cause of Overflow

- I & I - Rainfall
- Roots
- Grease
- Debris
- Equipment Failure
- Construction
- Vandalism
- Power Failure
- Line Failure/Break
- Other Cause:

Action Taken - Check all that apply

(Short term and long-term action, including clean-up and any plans to remediate I & I).

- Machine rodded
- Jet-Vac
- Hand rodded
- Used Generator To Power Pumps/Equipment
- Other: Describe
- Disinfected and Deodorized
- Hydro Cleaned
- Spread Lime on Affected Area
- Public Notification

Environmental Damage

- OEHC - Observed or Evidence of Human Contact
- OEEI - Observed or Evidence of Environmental Impact
- NEAH - No Evidence of Adverse Health/Environmental Impact
- EFK - Evidence of Fish Kill

Reported By **Jimmie B. Johnson**

Title **Superintendent**

Telephone Number **(474) 784-2231**

Additional Comments if Needed:

Email a Copy of This Report to the Email Address:

jjohnson@fsark.com

From: (479) 784-2330
Steve Floyd
City of Fort Smith
3900 Kelley Highway

Fort Smith, AR 72904

Origin ID: FSMA



J151215022303LV

Ship Date: 22APR15
ActWgt: 2.0 LB
CAD: 17311277/INET3610

Delivery Address Bar Code



SHIP TO: (501) 682-0638 **BILL SENDER**
NPDES Enforcement Section, Water
ADEQ
5301 Northshore Drive

North Little Rock, AR 72118


Ref #
Invoice #
PO #
Dept #

FRI - 24 APR AA
**** 2DAY ****


TRK# **7734 3191 7884**
0201

72118
AR-US
LIT

SA LITA

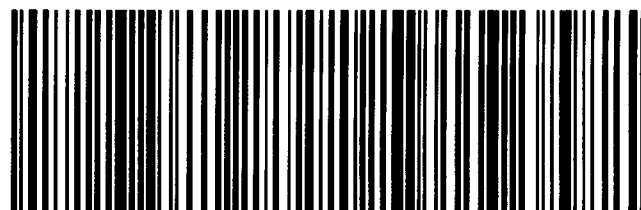

537J2/8FC5/EE4B

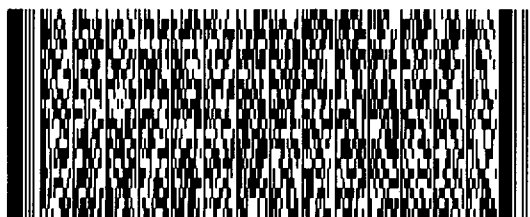

After printing this label:

1. Use the 'Print' button on this page to print your label to your laser or inkjet printer.
2. Fold the printed page along the horizontal line.
3. Place label in shipping pouch and affix it to your shipment so that the barcode portion of the label can be read and scanned.

Warning: Use only the printed original label for shipping. Using a photocopy of this label for shipping purposes is fraudulent and could result in additional billing charges, along with the cancellation of your FedEx account number.

Use of this system constitutes your agreement to the service conditions in the current FedEx Service Guide, available on fedex.com. FedEx will not be responsible for any claim in excess of \$100 per package, whether the result of loss, damage, delay, non-delivery, misdelivery, or misinformation, unless you declare a higher value, pay an additional charge, document your actual loss and file a timely claim. Limitations found in the current FedEx Service Guide apply. Your right to recover from FedEx for any loss, including intrinsic value of the package, loss of sales, income interest, profit, attorney's fees, costs, and other forms of damage whether direct, incidental, consequential, or special is limited to the greater of \$100 or the authorized declared value. Recovery cannot exceed actual documented loss. Maximum for items of extraordinary value is \$1,000, e.g. jewelry, precious metals, negotiable instruments and other items listed in our ServiceGuide. Written claims must be filed within strict time limits, see current FedEx Service Guide.

FSMA 81